

SECTION CORNER RECORD

MARION COUNTY, INDIANA

Sec. 36 Twp. 17 Range 4


DATE: 10-6-82 8/1/90

PREPARED BY: P.C. - Wilcoxon - Kiste

INSTRUMENT: - ROD. -


TYPE of MARKER: Harrison Monument COND. of MARKER: Good

METHOD of ESTABLISHMENT: See Corner History Below

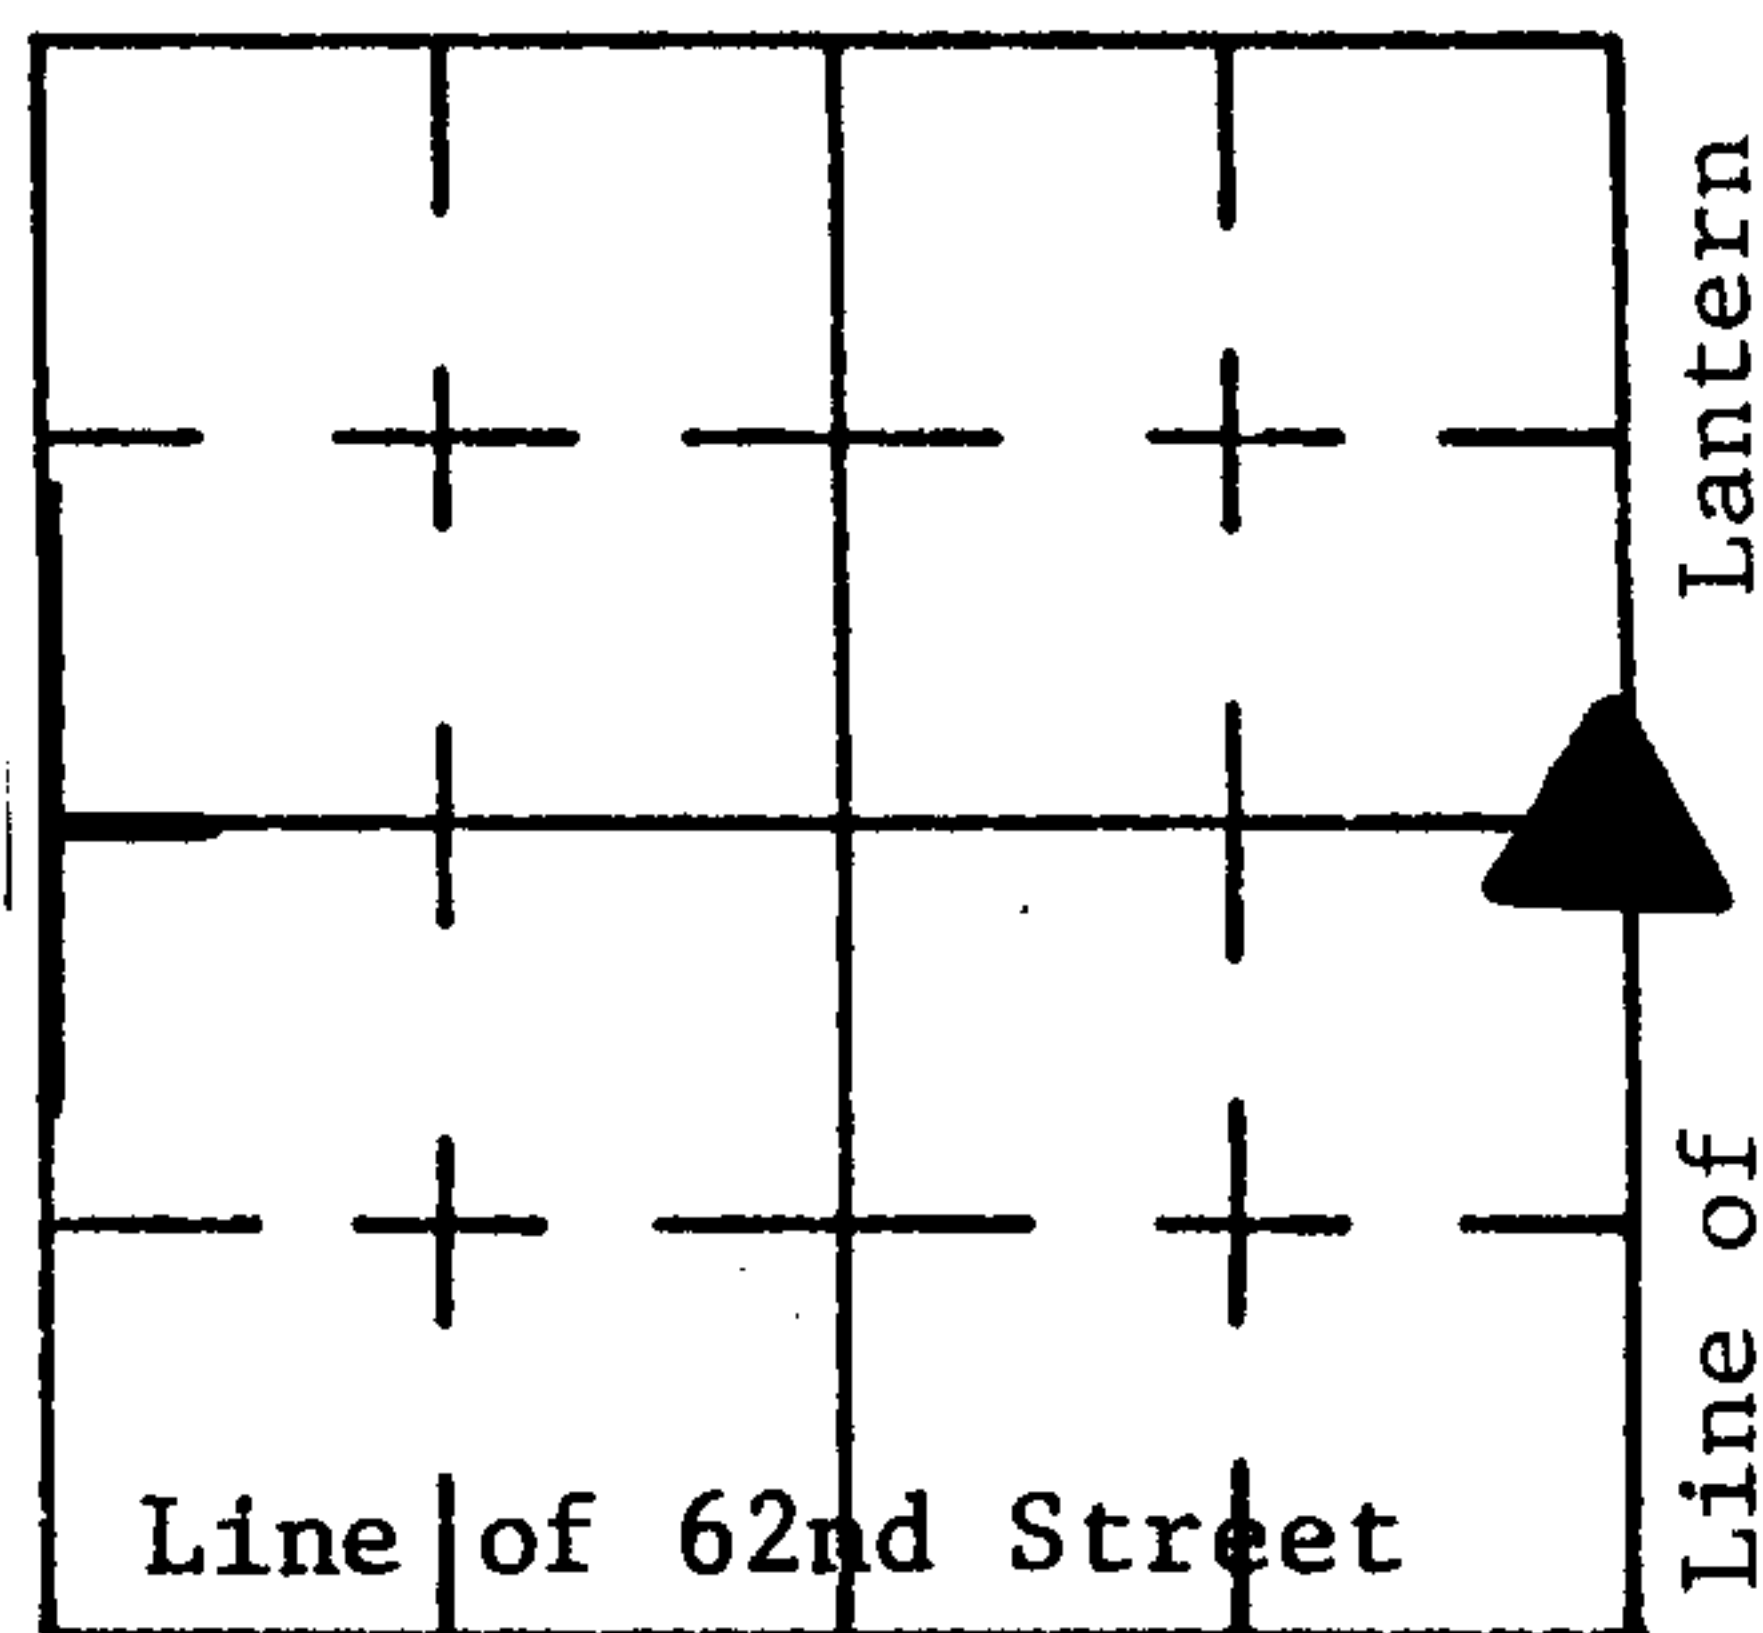

IN. S.P.C. E. ZONE, NAD 83.

NAME: 17053104
N: 513847.0306(m)
E: 70286.7088(m)

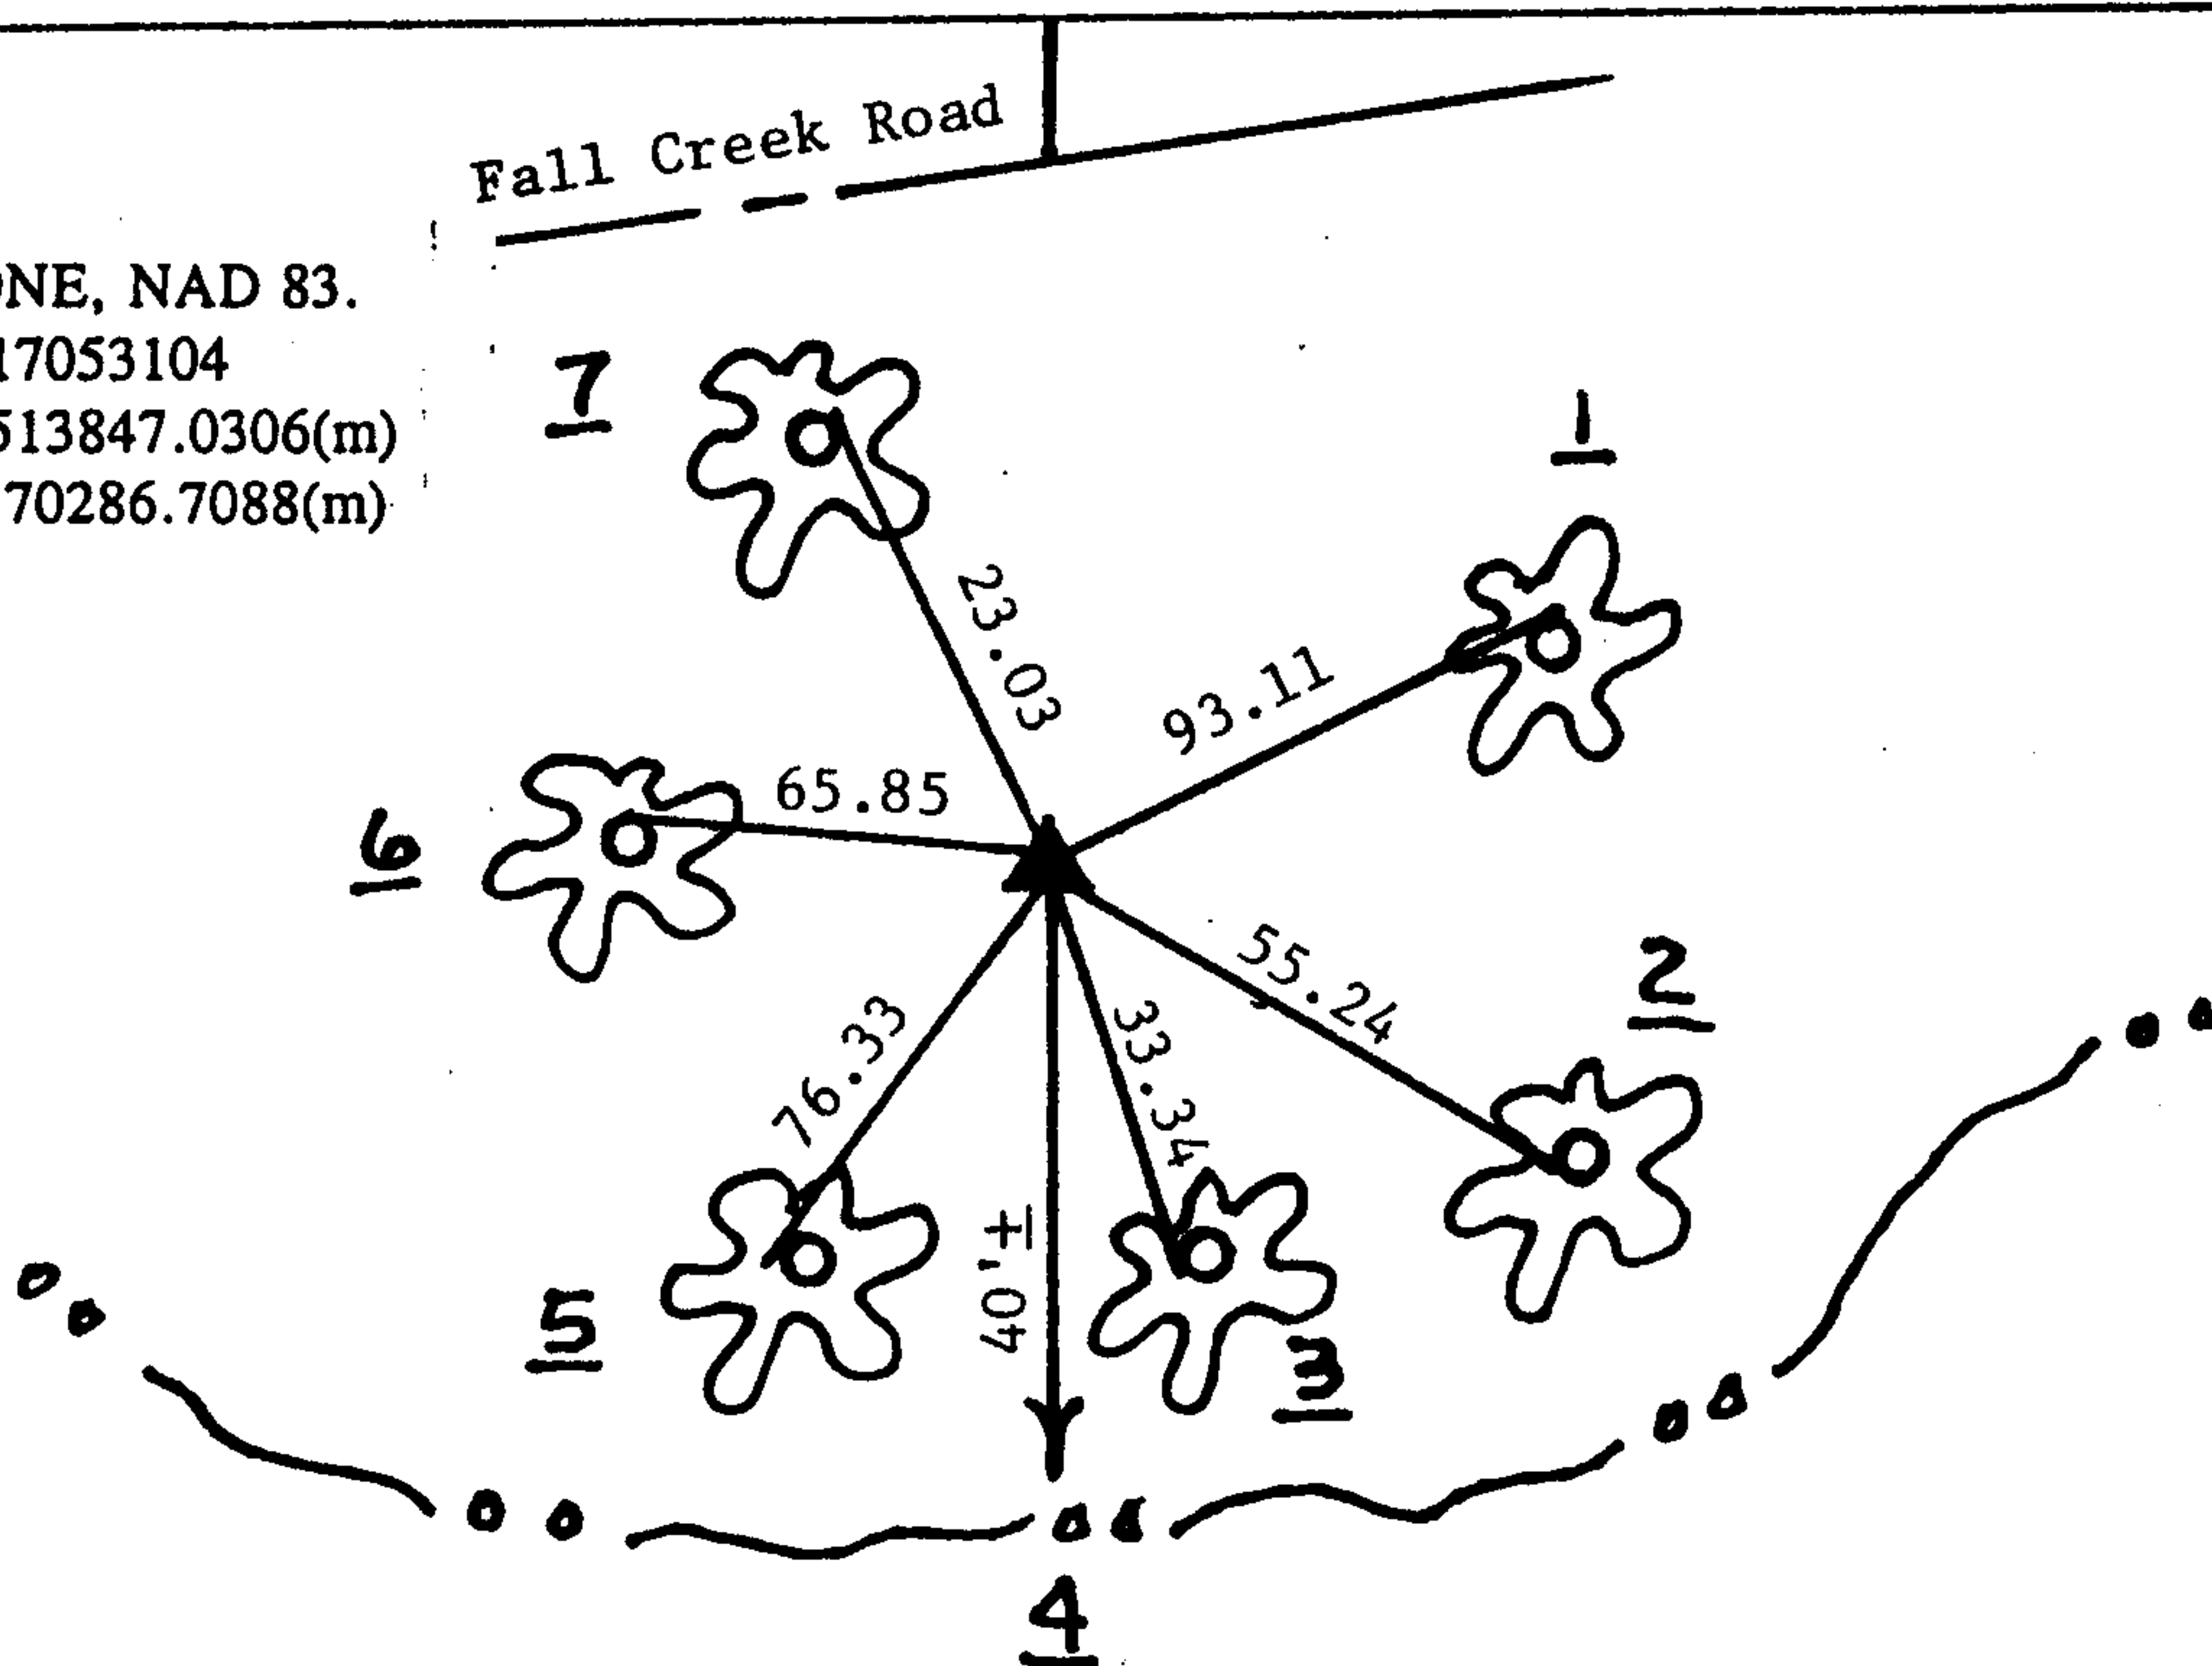

HC743606

CORNER HISTORY: This corner was not set in the original government survey. A Legal Survey in November 1855 by D.B. Hosbrook, Deputy Surveyor (Lawrence Legal Book, page 6) labels the East quarter corner of 36-17-4 "F" and gives distances to the North and West. A portion of the page is destroyed; however, it appears that no falling is given to the West quarter corner of 31-17-5. A Legal Survey in July 1866 by William P. Smith, Deputy County Surveyor (Lawrence Legal Book, Page 12) labels the corner "G", calls it a stone on brick and gives a witness tree. A distance is given to the Northwest corner of Section 31. A Legal Survey in November 1880 by Hervey Fatout, County Surveyor (Lawrence Legal Book, Page 38) labels the corner "4" and notes "Buckeye". A distance is given to the Northwest corner of Section 31. A survey of the Fort Benjamin Harrison boundary in May 1930 by George G. Schmidt, Inc. appears to indicate the corner and shows distances to adjacent boundary corners. No information is given on the corner itself. Schneider Engineering JOB#20134 (1980) indicates an iron pin with a cap set at the corner per a Fort Harrison boundary survey by Schmidt in 1937 (Quartermaster General Map #6138-128) Distances and bearings are given to corners to the North and East. A survey of the Fort Harrison boundary certified on November 16, 1981 by John V. Schneider (Schneider Engineering) indicates the East quarter corner of 36-17-4 as "U.S. Corps Monu. set." Distances are given to adjacent boundary corner, although they do not match the 1930 survey distances. Schneider knew of the double corner at this location, with the West quarter corner of 31-17-5 (iron pin set in concrete) falling \pm 7 feet South of the East quarter corner of 36-17-4 (US Corps monument); however, for specific reasons, chose to ignore the double corner for purposes of their survey and used only the East quarter corner of 36-17-4. The US Corps Monument and the iron pin in concrete were found destroyed in September 1982 by Wilcoxon. A Harrison #305 cast iron monument was reset by Wilcoxon on October 6, 1982 at the location of the West quarter corner of 31-17-5 using coordinates from the Schneider survey (JOB#20134).

1	93.11	Road nail N-side of 36" Sycamore Tree; leaning south
2	55.24	Road nail w/washer W-side of 36" Sycamore Tree by creek; 5' up
3	33.34	Road nail w/washer E-side of 10" Silver Maple Tree; by creek 1' up
4	40'+	to edge of water
5	76.33	Road nail w/washer N-side of 36" Cottonwood; 1' up
6	65.85	Road nail N-side of 30" Sycamore Tree; 2' up
7	23.03	Road nail E-side of 10" Sycamore Tree; 2' up